


**Male
Bore Through
Connector**

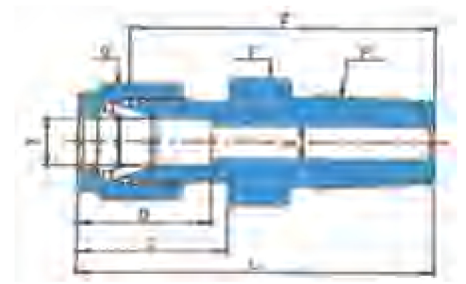

Fractional Range

Part No.	Tube O.D (T) inches	NPT (P*)	F Hex	L inches	C inches	t inches	B inches
1MC1 - BT	1/16	1/16	5/16	0.93	0.43	0.78	0.38
1MC2 - BT	1/16	1/8	7/16	1.03	0.43	0.88	0.38
1MC4 - BT	1/16	1/4	9/16	1.23	0.43	1.08	0.56
2MC1 - BT	1/8	1/16	3/8	1.17	0.60	0.91	0.38
2MC2 - BT	1/8	1/8	7/16	1.20	0.60	0.94	0.38
2MC4 - BT	1/8	1/4	9/16	1.40	0.60	1.14	0.56
3MC2 - B T	3/16	1/8	7/16	1.23	0.64	0.97	0.38
3MC4 - BT	3/16	1/4	9/16	1.43	0.64	1.17	0.56
4MC2 - BT	1/4	1/8	1/2	1.29	0.70	1.00	0.38
4MC4 - BT	1/4	1/4	9/16	1.49	0.70	1.20	0.56
4MC6 - BT	1/4	3/8	11/16	1.60	0.70	1.22	0.56
4MC8 - BT	1/4	1/2	7/8	1.87	0.70	1.47	0.75
5MC4 - BT	5/16	1/4	9/16	1.52	0.73	1.22	0.56
6MC4 - BT	3/8	1/4	5/8	1.57	0.76	1.28	0.56
6MC6 - BT	3/8	3/8	11/16	1.57	0.76	1.28	0.56
6MC8 - BT	3/8	1/2	7/8	1.82	0.76	1.53	0.75
6MC12 - BT	3/8	3/4	1 1/16	1.88	0.76	1.59	0.75
8MC8 - BT	1/2	1/2	7/8	1.93	0.87	1.53	0.76
8MC12 - BT	1/2	3/4	1 1/16	1.99	0.87	1.59	0.75
10MC12 - BT	5/8	3/4	1 1/16	1.99	0.87	1.59	0.75
12MC12 - BT	3/4	3/4	1 1/16	1.99	0.87	1.59	0.75
16MC16 - BT	1	1	1 3/8	2.46	1.05	1.97	0.94